


S45OE06Z



PLANFRÄSER FACE MILLING CUTTERS



γ_p	$+10^\circ$	κ_r	43°
γ_t	$+1^\circ - +6^\circ$	a_{max}	3,3 (10,7) mm

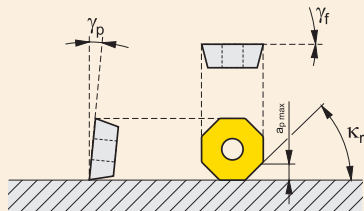


Abmessungen [mm]. / Dimensions [mm].

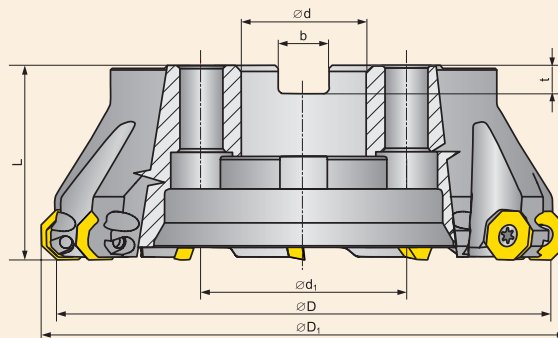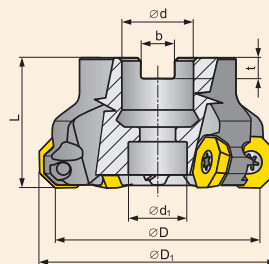


Z* – Anzahl Zähne / Number of teeth

[illegible]


S450E06Z

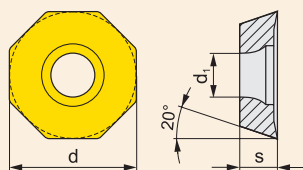PLANFRÄSER
FACE MILLING CUTTERS


OEHT 06

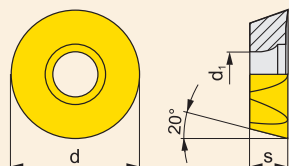


REHT 16

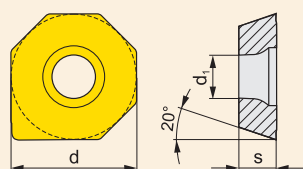


XEHT 06

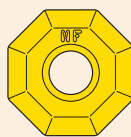


OEHT 06 MF

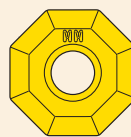


OEHT 06 MM

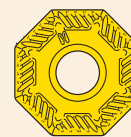


OEHT 06 M

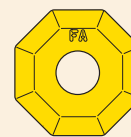


OEHT 06 FA

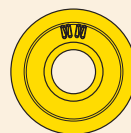

REHT 16 MM

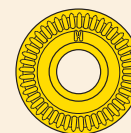

REHT 16 M

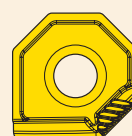

XEHT 06

WENDESCHNEIDPLATTEN (WSP) / INDEXABLE CUTTING INSERTS

ISO	Materialien / Grades							Abmessungen / Dimensions				
	M0315	M9325	M8310	M8340	8230	HF7		d	s	d ₁		
OEHT 0604AEER-MF			•	•	•			16,050	4,760	5,50		
OEHT 0604AEER-MM		•	•	•	•			16,050	4,760	5,50		
OEHT 0604AESR-M		•	•	•	•			16,050	4,760	5,50		
REHT 1604M0EN-MM		•	•	•	•			16,000	4,760	5,50		
REHT 1604M0SN-M		•	•	•	•			16,000	4,760	5,50		
OEHT 0604AEFR-FA	•					•		16,050	4,760	5,50		
XEHT 0604AESR			•					16,050	4,760	5,50		

ERSATZTEILE / SPARE PARTS

*) Empfohlene Torxschraube – siehe Seite / For screw torques see pages: 394 – 397.

Ø Fräser Ø Cutter	Spannschraube* Clamping screw*	Schraube für Messerkopf Screw for taper clamping	Schraubendreher Screwdriver	Spindelabdeckung Arbor cover	Abdeckungsschraube Cover screw	Schlüssel Key
						
50 – 70	US 5011-T20P	HS 1030C	SDR T20P-T	-	-	-
80 – 125	US 5011-T20P	-	SDR T20P-T	-	-	-
160	US 5011-T20P	HS 1240C	SDR T20P-T	CAC160C	HSD 0825C	HXK 5
200	US 5011-T20P	HS 1655C	SDR T20P-T	CAC200C	HSD 1025C	HXK 7